

DIGITUS Optički multimode prespojni kabel, OM4, LC / LC

DK-2533-10-4
EAN 4016032308843



AL 5LCLC-10/4I PATCH 50UM 10M OM4 MM OM4 50/125 æ, 10 m

Optički prespojni kabel, dupleks, LC na LC, MM OM4 50/125 µ, 10 m




Vrhunska kvaliteta Vaše mreže osigurava oprema izrađena po standardima budućnosti.

- Dupleks kabel
- LSOH
- Konektor s keramičkom ferulom
- Promjer kabela 2 mm
- Pakiranje 1 komad sa uključenim izvještajem sa ispitivanjem
- Boja: RAL 4003
- Ambalaža: DIGITUS Polybag
- Asortiman: Patch kabeli s optičkim vlaknima

- Broj konektora strane 1: 2
- Broj konektora strane 2: 2
- Kabelski omotač: LSOH
- Klasa vlakna: OM4
- Konektor 1: LC
- Konektor 2: LC
- Mod: Višemodni
- Promjer kabela: 2 mm
- Promjer vlakna: 50/125µ
- Stopica: jednobojna
- Vrsta kabela: I-VH 2G50/125µ
- Duljina: 10 m

Logistics						
	Number (pcs)	Weight (kg)	Depth (cm)	Width (cm)	Height (cm)	cm ³
Packaging Unit Carton	40	30.00	41.00	41.00	28.00	47.07
Packaging Unit Inside	5	3.75	19.00	19.00	12.00	4.33
Packaging Unit Single	1	0.75	17.00	17.00	2.40	693.60
Net single without Packaging	0	0.14	15.00	15.00	2.40	540.00

More images:

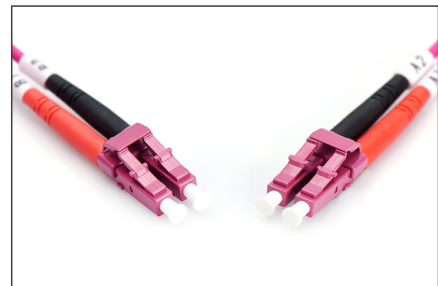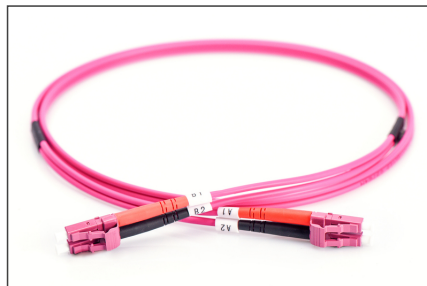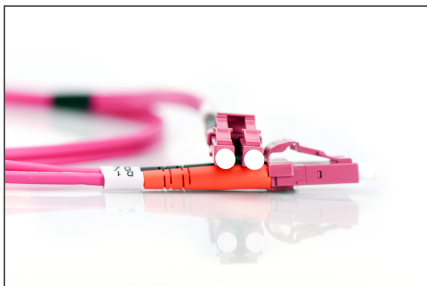

Part No.	DK-2533-10-4			
Lenght	10 m			
Cable Type	Duplex MM 50/125		OM4 LSZH	
	END A		END B	
Connector Type	LC		LC	
Insertion Loss (dB)	0.06	0.09	0.17	0.11
Return Loss (dB)	37.7	30.1	39.5	39.7
Q.C.	PASS			

Safety notes

- Avoid direct contact with light sources: Fiber optic cables, especially those with active light sources such as lasers (e.g. in optical communication systems), can emit dangerous radiation that can damage
- eyes. Take care never to look directly into the light of an optical fiber, even if the light source is invisible to the naked eye.
- When working with fiber optic cables, especially during tests or when working with lasers, protective goggles should always be worn to protect against harmful radiation.
- When plugging and unplugging the cable, only grasp the plug and do not pull directly on the cable.
- Do not kink or crush: Fiber optic cables are sensitive to mechanical stress.
- To protect cables from physical damage, they should be laid in special ducts or with protective materials
- Keep cable connectors clean: Fiber optic cables are sensitive to dust and dirt. Even small particles on the connectors can severely impair the signal quality.
- Cables should not be used in environments with extremely high or very low temperatures. Observe the product information on the maximum operating temperature of the cable
- Check cables regularly for visible damage such as cracks, kinks or signs of wear. Defective cables should be replaced immediately.

EU responsible person

EU based economic operator ensuring the product complies with the required regulations.

ASSMANN Electronic GmbH
 Auf dem Schüffel 3
 Lüdenscheid, Germany
<https://www.assmann.com>
info@assmann.com